


DIGITAL FORCE GAUGE

- ☐ DB25-204FM-2KN
- ☐ DB25-204FM-5KN
- ☐ DB25-204FM-10KN
- ☐ DB25-204FM-20KN
- ☐ DB25-204FM-50KN
- ☐ DB25-204FM-100KN

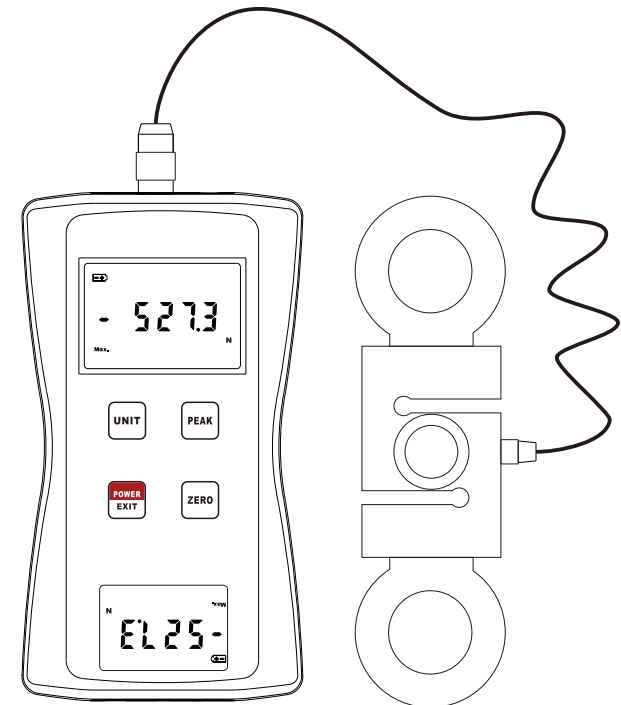

This Force Gauge is small in size, light in weight, easy to carry. Although complex and advanced, it is convenient to use and operate. Its ruggedness will allow many years of use if proper operating techniques are followed. Please read the following instructions carefully and always keep this manual within easy reach.

CONTENT

1. INTRODUCTIONS	1
2. FUNCTIONS AND FEATURES	1
3. TECHNICAL PARAMETERS	2
4. STRUCTURE DESCRIPTION	3
4.1 Overall Structure	3
4.2 Display	4
4.3 Operation Key	5
5. POWER ON & POWER OFF	5
5.1 Power On	5
5.2 Power Off	5
6. CALIBRATION	5
7. REAL TIME MEASUREMENT MODE & PEAK HOLD MODE	6
8. UNIT CONVERSION FUNCTION	6
9. SETTING OF AUTO POWER OFF	6
10. INSTALLATION & MEASUREMENT	6
11. BATTERY REPLACEMENT	7
12. SECURITY AND CAUTIONS	7

13. ACCESSORIES

Standard Accessories	Digital Force Gauge
	Sensor (M12 Screw Hole)
	2 Suspension Links
	Manual
	Carrying Case
Optional Accessories	Power Adapter

- B. If it is to test the impact load, please select models with safe load at least double as large as the impact load.

12.2 Warning

- A. In destructive testing, protective masks and gloves should be worn to prevent the occurrence of the damage to the human body because of material splashing during testing.
- B. Do not use fixtures which have been damaged or severely bent. For users, please refer to the relevant specifications in this manual when using a self-made fixture (various types of fixtures are provided for customers to select according to need).
- C. Do not test force exceeding the maximum range of the gauge. Otherwise it may cause damage to the sensor, or even an accident.
- D. When the tested force exceeds 110% of the range, a continuous buzzer alarm comes out. In this case, please remove the load quickly, or reduce the load.

12.3 Security Items

- A. When using the power adapter, the voltage of power supply should be the same as the rated voltage, or it may cause electric shock or fire.
- B. Do not pull out or insert the plug with wet hands, or it may lead to electric shock.
- C. Don't pull the cable of the power adapter to pull the plug, to avoid wire broken and electric shocks.
- D. Please use a soft cloth to clean the gauge. Soak the cloth in the water with cleaning agent, wring it out, and then use it to remove the dust and dirt.
Note: do not use volatile chemicals to clean the gauge (such as volatile agents, thinner, alcohol, etc.)
- E. Do not use the gauge in the following environment,
1. Wet environment
2. Dusty environment
3. The place where with the use of chemicals or oil
4. The place where with vibration source
- F. After use, please put the force gauge into the portable box, to protect the testing shaft from the external impact.
- G. This gauge is a high-precision integrated electronic gauge with the LCD. Do not impact or extrude.
- H. Do not disassemble or repair the machine by yourself, which may cause permanent fault of the gauge.

1. INTRODUCTIONS

DBFM-2204 series force gauge is the latest designed force gauge, which is researched and developed by our company. It has the advantages of high accuracy, easy operation and easy to carry. It has the peak value hold function. The measurement data can be memorized into the gauge or transmitted to the computer for statistical analysis. Being installed with a variety of test bench and fixture, it can become a test machine for different uses.

The digital force gauge has a number of models with different force range for the user to choose, the user can select the appropriate model according to the force of tested products. The scientific test method is to use 10%~100% of the full test range. The measurement department recommends not to use <1% of the full test range. Before testing, when the instrument and the test object have been in place, press ZERO key to clear the load of the fixture.

The digital force gauge is a kind of simple and convenient multi-functional instrument for high-accuracy push force and pull force test. It is widely used in electronics, building hardware, textile, auto parts, ignition device such as lighter, fire fighting equipment, pen manufacturing, lock manufacturing, fishing gear, chemical, power machinery, scientific research institutions and other industries. For the push and pull load test, plug and unplug force test and destructive test etc. With digital display, high resolution, high sampling speed, easy testing procedure, it is an efficient and high-accuracy instrument for push force and pull force test in the new generation.

2. FUNCTIONS AND FEATURES

- * High accuracy and high resolution.
- * Digital display with no guessing or errors.
- * With 4 measurement unit for selection and conversion, N, kg, lb.
- * With peak value hold function.
- * With 10 minutes auto power off and manual power off.
- * Power can be supplied by either alkaline battery or 5V DC power.

3. TECHNICAL PARAMETERS

Model	DB25-204FM-2KN	DB25-204FM-5KN	DB25-204FM-10KN	DB25-204FM-20KN	DB25-204FM-50KN	DB25-204FM-100KN
Force Range	±200kgf	±500kgf	±1000kgf	±2000kgf	±5000kgf	±10000kgf
	±1960N	±4900N	±9800N	±9999N	±49000N	±98000N
	±440Lbf	±1100Lbf	±2200Lbf	±4400Lbf	±11000Lbf	±22000Lbf
Resolution	0.01kgf (<100kgf) 0.1kgf (≥100kgf)	0.01kgf (<100kgf) 0.1kgf (≥100kgf)	0.01kgf (<100kgf) 0.1kgf (≥100kgf)	0.01kgf (<100kgf) 0.1kgf (≥100kgf)	0.01kgf (<100kgf) 0.1kgf (≥100kgf)	0.01kgf (<100kgf) 0.1kgf (≥100kgf)
	0.1N (<1000N) 1N (≥1000N)	0.1N (<1000N) 1N (≥1000N)	0.1N (<1000N) 1N (≥1000N)	0.1N (<1000N) 1N (≥1000N)	0.1N (<1000N) 1N (≥1000N)	0.1N (<1000N) 1N (≥1000N)
	0.1Lbf	0.1Lbf (<1000Lbf) 1Lbf (≥1000Lbf)	0.1Lbf (<1000Lbf) 1Lbf (≥1000Lbf)	0.1Lbf (<1000Lbf) 1Lbf (≥1000Lbf)	0.1Lbf (<1000Lbf) 1Lbf (≥1000Lbf)	0.1Lbf (<1000Lbf) 1Lbf (≥1000Lbf)
Accuracy	± 0.5%FS ± 1Digit					
Unit	kgf, N, Lbf					
Measurement State	Peak Value Measurement, Real Time Measurement					
Display	2 Reversed 4 Digit Lcd					
Power Off	10 Minutes Auto Power Off, Manual Power Off					
Backlight	Blue Backlight					
Safe Load	150%FS (Buzzer Alarm Over 110%FS)					
Power Supply	2x1.5 AA(UM-3) Battery or 5V DC Power Supply					
Operating Conditions	Temperature: 0~40°C					
	Humidity: <80%					
Surrounding	No Vibration Source or Corrosive Medium Around					
Case Size	199x76x37mm					
Sensor Size	181x54x30mm					

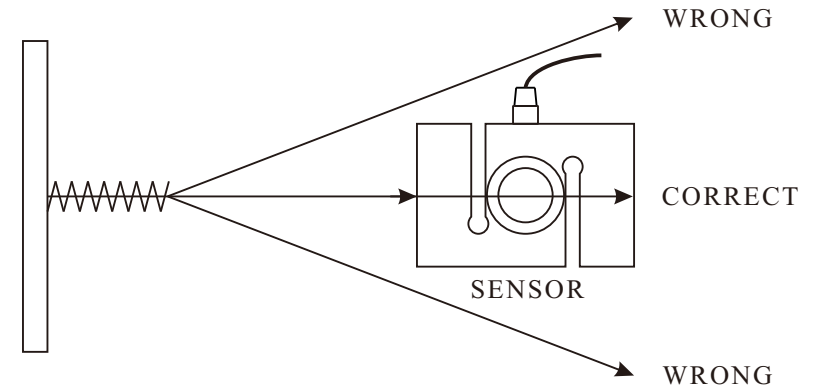


Fig 4 The Correct Measurement Direction

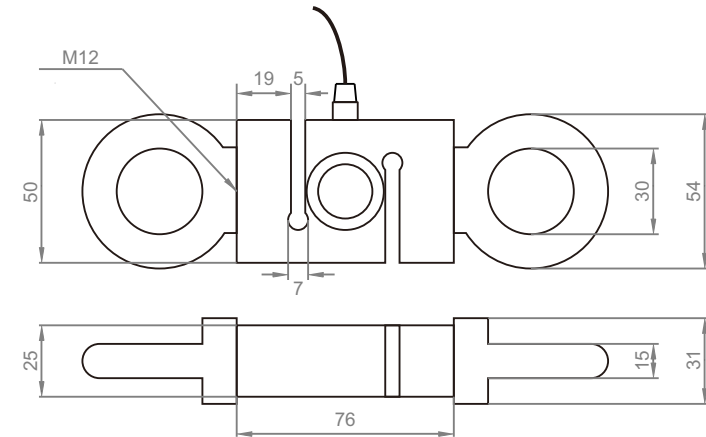


Fig 5 Shape And Installation Dimensions

11. BATTERY REPLACEMENT

- 11.1 When it is necessary to replace the battery, the battery symbol will appear on the Display.
- 11.2 Slide the Battery Cover away from the gauge and remove the batteries.
- 11.3 Install new batteries correctly into the case.
- 11.4 If the gauge is not to be used for any extended period, remove batteries.

12. SECURITY AND CAUTIONS

12.1 Cautions

- A. If the operation is incorrect, it is possible to damage the gauge or cause serious accident. In the manual, the important items of accident prevention and measurement procedure of the gauge are pointed out. Please read this manual carefully before measurement, keep it properly after reading, in preparation to read again.

* When the weight of the used fixture is more than 20% of the range, or the load of the gauge is more than 20% of the range, the gauge is not able to be calibrated. In this case, it is necessary to use a lighter fixture or remove the load, then calibrate.

7. REAL TIME MEASUREMENT MODE & PEAK HOLD MODE

Two kinds of measurement modes can be set for this gauge, the Real Time Measurement Mode and the Peak Hold Mode.

When there is no peak indicator "MAX" on the display, it is in the Real Time Measurement Mode. The displayed test value changes according to the load.

Press the Peak Value Key (PEAK), the peak indicator "MAX" comes out on the display. It is in the Peak Hold Mode. The displayed test value is the maximum value during the measurement.

8. UNIT CONVERSION FUNCTION

In either Real Time Measurement Mode or Peak Hold Measurement Mode, press the Unit Key (UNIT) for measurement unit conversions.

9. SETTING OF AUTO POWER OFF

When the gauge is powered on, press and hold the Power/Exit Key (POWER/EXIT) for about 3 seconds. Release the key when the indicator 'Auto' (AUTO) comes out on the display.

A figure, '10' or '0', comes out on the display. Respectively indicating auto power off in 10 minutes with no key operations and non-auto power off. Press the Save/Upward Key (SAVE/▲) or the Read/Downward Key (READ/▼) to convert between these two settings. Press the Power/Exit Key (POWER/EXIT) to quit.

10. INSTALLATION & MEASUREMENT

Power on the gauge, press operation keys to select the intended measurement mode according to the need, or measure directly with the factory default settings.

- Select appropriate test fixtures to install on the sensor (to use self-made fixtures, please refer to the relevant datas on the next page 'Shape And Installation Dimensions').
- When measuring, please hold the sensor firmly or install it on a suitable test machine. Please make the force and the central axis of sensor in a straight line, so that measurements of load are accurate.
- After the measuring, remove the load, turn off the gauge, remove the fixtures, and then put the items back in the tool box after cleaning, in order to prepare for the next use.

4. STRUCTURE DESCRIPTION

4.1 Overall Structure

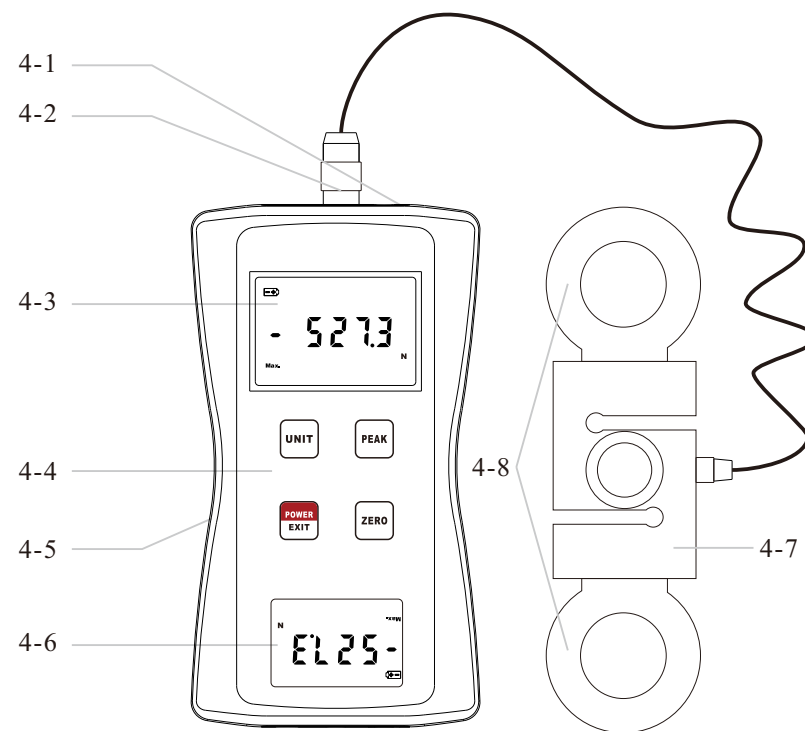


Fig 1 Overall Structure

Function Description Of Overall Structure

4-1 Power Interface

It can be connected with 5V DC Power for power supply.

4-2 Sensor Plug

It is used to connect main unit and sensor.

4-3 Display A

It is used to display the readings of measurement, units of measurement, the indications of the operation, etc.

4-4 Operation Key Area

All operation keys are distributed on this area. Thus, all keys of the gauge can be found here.

4-5 Battery Case On The Back

The place to install batteries, for battery supply.

4-6 Display B

It is also used to display the readings of measurement, units of measurement, the indications of the operation, etc. It is designed for more convenient reading on multiple directions.

4-7 Sensor

It is used to convert the received force information into electrical signals to main unit.

4-8 Suspension Link

It is used to hang the tested object and connect the measured system.

4.2 Display

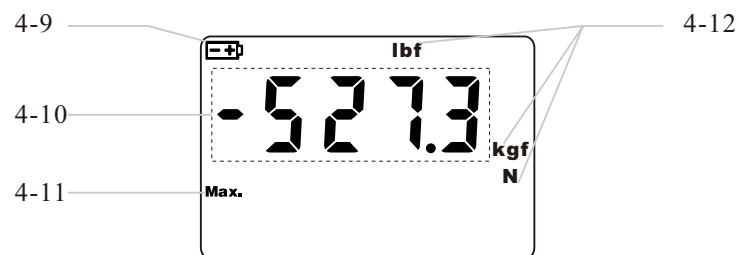


Fig 2 Display

Function Description Of Display

4-9 Battery Indicator ‘’

When the battery voltage is low, ‘’ comes on the top left corner of the display, indicating it is lack of voltage and the batteries need to be replaced.

4-10 Displayed Reading

In this gauge, the pushing force is a positive value (not shown "+"); the pulling force is a negative value (display "-").

4-11 Peak Value Indicator MAX.

When the indicator ‘MAX.’ comes, it indicates that it is in Peak Value Hold Mode, in which the displayed reading is the peak value during measurement. When the indicator ‘MAX.’ does not come, it indicates that it is in Real Time Measurement Mode, in which the displayed reading changes according with the applied load.

4-12 Measurement Unit

It indicates the current measurement unit, which includes ‘kgf’, ‘gf’, ‘N’, ‘lbf’.

4.3 Operation Key

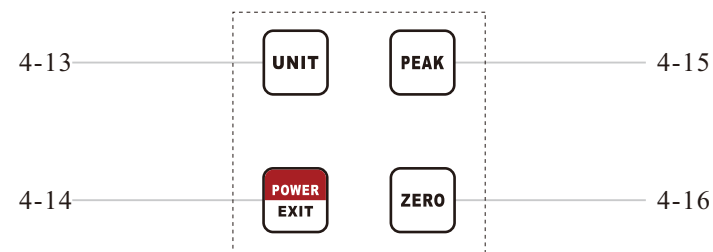


Fig.3 Operation Key

Function Description Of Operation Key

4-13 Unit Conversion Key(UNIT)

It is the key for unit conversion.

4-14 Power/Exit Key(POWER/EXIT)

It is the key for powering on/off the gauge. Also, it is the key for exiting from Data Scanning Mode. What’s more, it is the key for going into the Auto Power Off Settings.

4-15 Peak Value Key(PEAK)

It is the key for conversion between the Peak Value Hold Mode and the Real Time Measurement Mode.

4-16 Zero Key(ZERO)

It is the key for zero calibration of the gauge.

5. POWER ON & POWER OFF

5.1 Power On

Install the batteries correctly or plug in the DC power supply. Then press the Power/Exit Key(POWER/EXIT) to power on the gauge.

5.2 Power Off

5.2.1 Manual Power Off

In the state of power-on, press and hold the Power/Exit Key (POWER/EXIT) for about 2 seconds, the indicator ‘**OFF**’ comes out. Then release the key, the gauge is powered off.

5.2.2 Auto Power Off

Auto power off function can be activated by user. When it is activated, the gauge will be powered off automatically after 10 minutes with no key operation. For details, please refer to 15 Setting Auto Power Off.

6. CALIBRATION

Install the gauge at the position of measurement according to the requirements. Then press the Zero Key (ZERO) to calibrate the gauge, the value of 0 comes out on the display.