


SWITCH FUNCTION

NO. POLES	UL/CSA MODEL NO.	MODEL NO.	SWITCH FUNCTION			CONNECTED TERMINALS / SCHEMATIC		
			POS.1	POS.2	POS.3	POS.1	POS.2	POS.3
								
SP	Q22A11	2AS1	ON	NONE	ON	2-3 	N/A	2-1
	Q22A12	2AS2	ON	NONE	MOM		OPEN	
	Q22A13	2AS3	ON	OFF	ON			
	Q22A14	2AS4	MOM	OFF	MOM			
	Q22A15	2AS5	ON	OFF	MOM			
	Q22A16	2AS6	OFF	NONE	ON	OPEN	N/A	3-1
DP	Q22A21	2AD1	ON	NONE	ON	2-3,5-6 	N/A	2-1,5-4
	Q22A22	2AD2	ON	NONE	MOM		OPEN	
	Q22A23	2AD3	ON	OFF	ON			
	Q22A26	2AD6	ON	ON	ON	2-3,5-6	2-3,5-4	2-1,5-4




MOM=MOMENTARY

POLE OPTIONS



SPDT

Part No. Shown : 2AS1T1A1M2RE

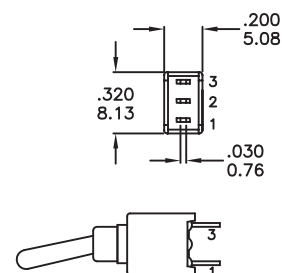
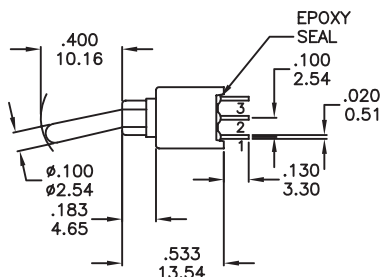
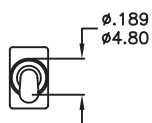


2AS6 Models : Omit 2nd terminal




DPDT

Part No. Shown : 2AD1T1A2M2RE

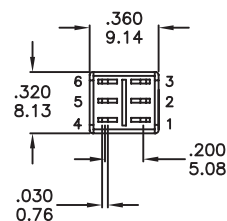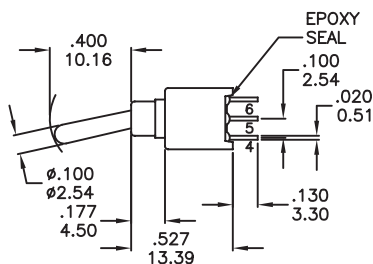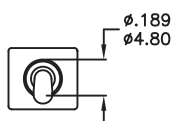


TERMINATION OPTIONS


M2

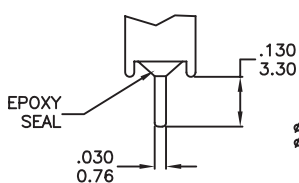

P.C. MOUNTING

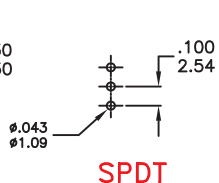

SPDT

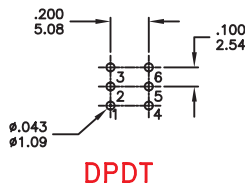

DPDT

OTHER TERMINATION OPTIONS

- M6 RIGHT ANGLE P.C. MOUNT
- M6N RIGHT ANGLE P.C. MOUNT SNAP-IN BRACKET
- M7 RIGHT ANGLE P.C. MOUNT
- VS2 VERTICAL BRACKET P.C.MOUNT